

<b>Subject:</b> <b>KEY REMINDER CHIME KEEPS CHIMING OR KEYLESS ENTRY INOPERATIVE</b>	<b>Bulletin No:</b> 09-032/06
	<b>Last Issued:</b> 07/21/2006

## BULLETIN NOTE

This bulletin supersedes the previous bulletin issued on 07/18/06. The SUBJECT has been revised.

## APPLICABLE MODEL(S)/VINS

2004 - 2006 Mazda3 vehicles with VINs lower than JM1 BK\*\*\*\* \*\*526084 (produced before April 18, 2006)

2006 Mazda5 vehicles with VINs lower than JM1 CR\*\*\*\* \*\*125853 (produced before April 18, 2006)

## DESCRIPTION


On some vehicles, the key reminder chime keeps chiming even though the key is pulled out of the ignition. In addition, the doors cannot be locked with the keyless entry system. This is caused by an internal failure from a contact plate that was not properly molded.

Customers having this concern should have their vehicle repaired using the following repair procedure.


## REPAIR PROCEDURE

1. Verify customer concern.
2. Record the customer's radio station presets.
3. Disconnect the negative battery cable.
4. Remove the column cover. Refer to Mazda3 Workshop Manual section 09-17 COLUMN COVER REMOVAL/INSTALLATION or Mazda5 Workshop Manual section 09-17 COLUMN COVER REMOVAL/INSTALLATION.

5. Remove the ignition switch from the steering lock.

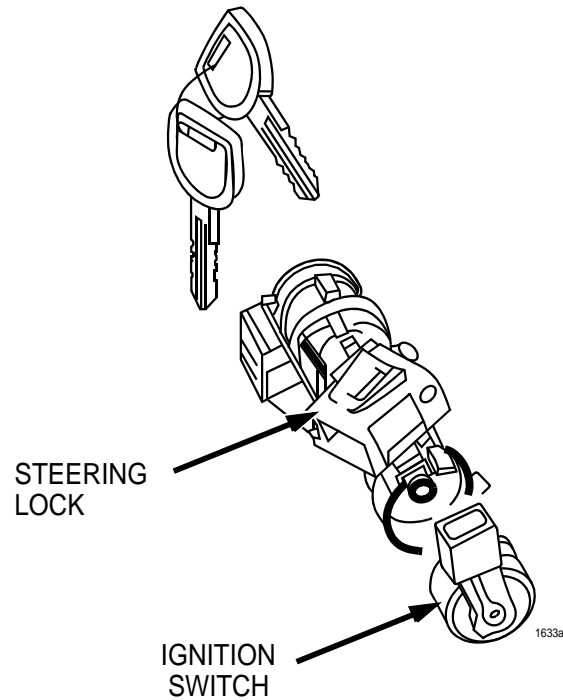

6. Disconnect the connector from the ignition switch by pulling down on the lever.

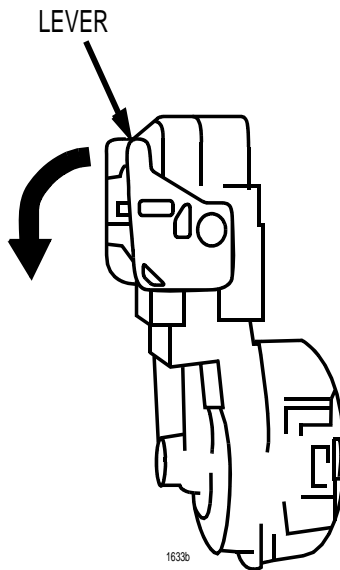

7. Reconnect the connector to the new ignition switch.  
8. Install the new ignition switch.  
9. Install the column cover.  
10. Reconnect the negative battery cable.  
11. Verify repair.  
12. Reset the customer's radio station presets.

## PART(S) INFORMATION

Part Number	Description	Qty.
BP4K-66-151B	Ignition Switch	1

## WARRANTY INFORMATION

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	64
Damage Code	9W
Part Number Main Cause	BP4K-66-151A
Quantity	1
Operation Number / Labor Hours:	XXB318R1 / 0.4 Hrs (Mazda3) XXB318R2 / 0.3 Hrs (Mazda5)