

01-019/12 - 2012 MAZDA5 - MIL ON WITH DTC P0451:00

SI107224

TSB NUMBER: 01-019/12

DESCRIPTION

APPLICABLE MODEL(S)/VINS

2012 Mazda5 vehicles with VINs lower than JM1CW*****138553 (produced before April 10, 2012)

DESCRIPTION


Some vehicles may experience the MIL on with DTC P0451:00 stored in memory. This is caused by foreign material adhering to the fuel tank pressure (FTP) sensor. To prevent this from happening, the installation angle of the FTP sensor has been changed.

P0451:00: Fuel tank pressure sensor range/performance problem

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Disconnect the negative battery cable.
3. Lift the vehicle up on a hoist.
4. Remove the original evaporation hose assembly (A) and short cord (B), and discard them. Refer to MGSS online instructions or Workshop Manual section 01-16 [CHARCOAL CANISTER REMOVAL/INSTALLATION \[MZR 2.5\]](#).

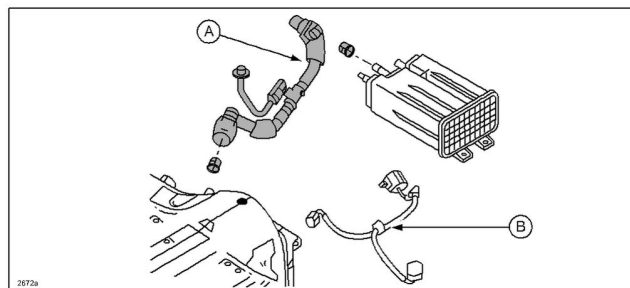

5. Install the modified evaporation hose assembly (with FTP sensor) and short cord.
6. Lower the vehicle.

7. Connect the negative battery cable.
8. Clear the DTC stored in the PCM.
9. Verify repair.

PARTS INFORMATION

Part Number	Description	Qty.
CG36-42-580A	Evaporation Hose Assembly (with FTP sensor)	1
L5E1-18-791A	Short Cord	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	6X
Damage Code	93
DTC Code	P0451
Part Number Main Cause	CG36-42-580A
Quantity	1
Operation Number / Labor Hours:	XXH2BXRX / 0.4 Hrs.
