

Subject: SQUEAKING NOISE FROM FRONT SUSPENSION WHEN PASSING OVER A BUMP	Bulletin No: 02-002/06
	Last Issued: 3/22/2006

APPLICABLE MODEL(S)/VINS


2004-2006 Mazda3 vehicles with VINs lower than JM1 BK**** ** 483440 (produced before January 27, 2006)

DESCRIPTION

Some vehicles may exhibit a squeaking noise from the front suspension when passing over a bump at a low speed. This is may be caused by one of the following.

- The front lower arm making contact with the bushing, causing a squeaking noise.
- The fluid in the rear bushing makes an unusual noise.

Customers having this concern should have their vehicle repaired using the following repair procedure.

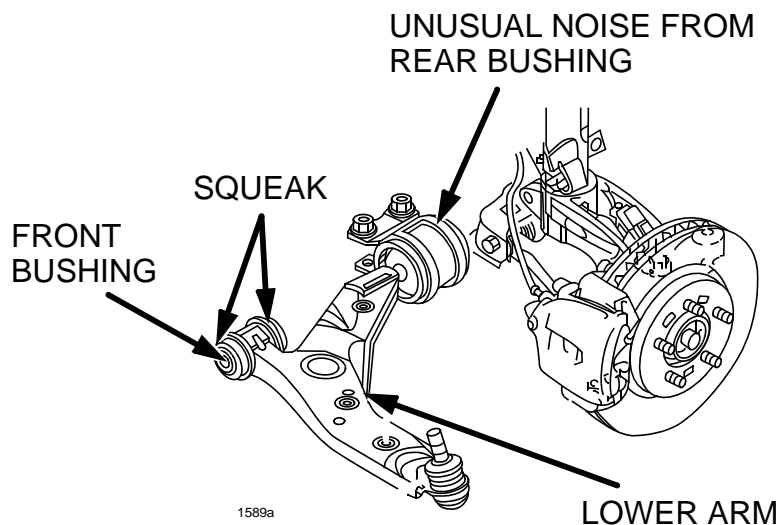

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace front lower arm. Refer to appropriate Workshop Manual section 02-13 - FRONT LOWER ARM REMOVAL / INSTALLION.
3. Perform toe-in inspection and adjustment. Refer to appropriate Workshop Manual section 02-11 - WHEEL ALIGNMENT.

Bulletin No: 02-002/06 © 2006 Mazda Motor of America, Inc.	Last Issued: 3/22/2006
--	-------------------------------

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
B32H-34-300D	Lower Arm Assembly (R)	1	---
B32H-34-350D	Lower Arm Assembly (L)	1	---

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	82
Damage Code	9B
Part Number Main Cause	SEE PART(S) INFORMATION
Quantity	1
Operation Number / Labor Hours:	XXB262R1 / 1.6 Hrs (One Side) XXB262R2 / 2.1 Hrs (Both Sides)