



[Home](#) [View Content](#) [Other Applications](#) [As Built Data](#) [IDS](#) [Training](#) [Return To Search Results](#) [Print](#) [Help](#) [Change Locale](#)

VIN

or

Model Year

Model

Ask Your Question Here

TSB

☐ General Information☐ Engine☐ Suspension☐ Transmission/Transaxle☐ HVAC☐ Wiring Diagram☐ Multiplex Communication System☐ Steering☐ Brakes☐ DriveLine/Axle☐ Restraints☐ Body/Accessories


[< Previous](#) [Next >](#)

2013 - CX-5 - Body and Accessories



DECORATION PANEL REMOVAL/INSTALLATION

CAUTION:

- Affix protective tape to the position shown in the figure.

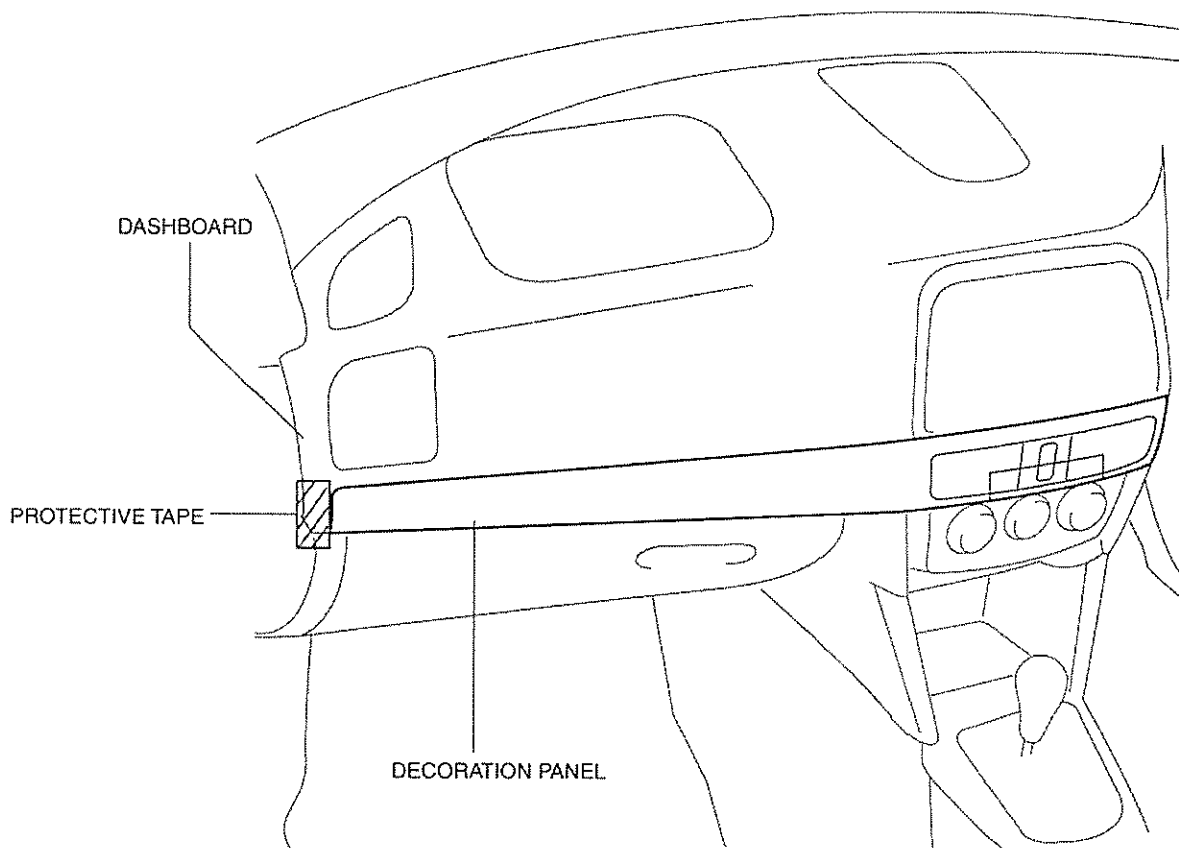

1. Disconnect the negative battery cable. (See [NEGATIVE BATTERY CABLE DISCONNECTION/CONNECTION \(SKYACTIV-G 2.0\)](#).)
2. Open the glove compartment.
3. Insert a tape-wrapped flathead screwdriver in the position indicated by the arrow (1) in the figure and detach clip A.

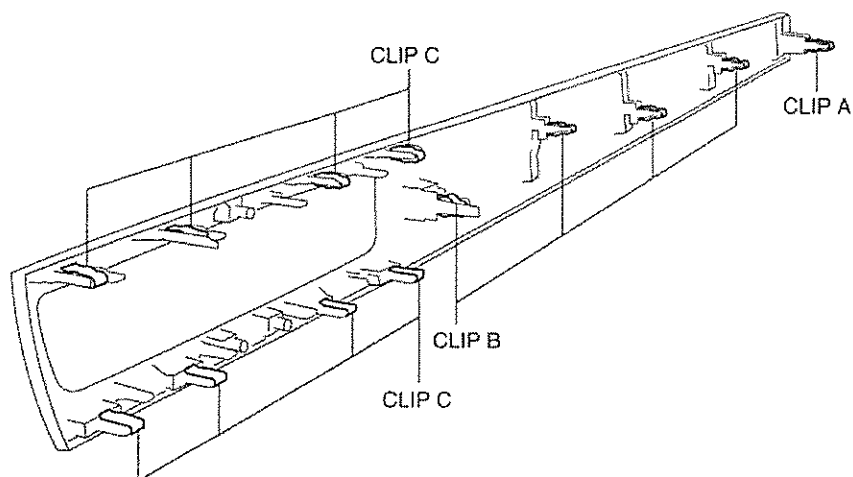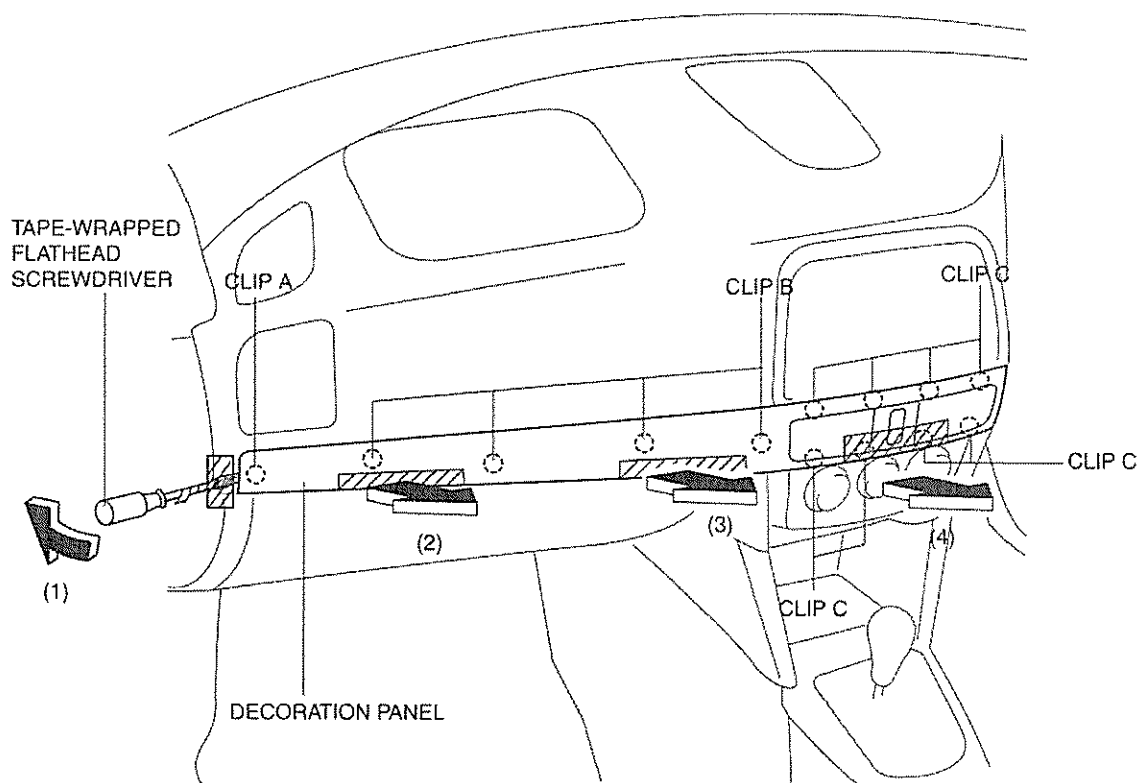

4. Take the shaded area shown in the figure, and remove the decoration panel in the direction of the arrow in the order of (2), (3), (4) while detaching clips B, clips C.
5. Disconnect the hazard switch connector.
6. Install in the reverse order of removal.

[< Previous](#) [Next >](#)

© 2012 Mazda North American Operations, U.S.A.

[Back to Top](#)



[Home](#) [View Content](#) [Other Applications](#) [As Built Data](#) [IDS](#) [Training](#) [Return To Search Results](#) [Print](#) [Help](#) [Change Locale](#)

VIN or Model Year Model Ask Your Question Here TSB
General Information ☐ Engine ☐ Suspension ☐ Transmission/Transaxle ☐ HVAC ☐ Wiring Diagram ☐
Multiplex Communication System ☐ Steering ☐ Brakes ☐ DriveLine/Axle ☐ Restraints ☐ Body/Accessories ☐


[< Previous](#) [Next >](#)

2013 - CX-5 - Body and Accessories

AUDIO UNIT REMOVAL/INSTALLATION

Removal


1. Disconnect the negative battery cable.
2. Remove the decoration panel. (See [DECORATION PANEL REMOVAL/INSTALLATION](#).)
3. Remove the bolt.

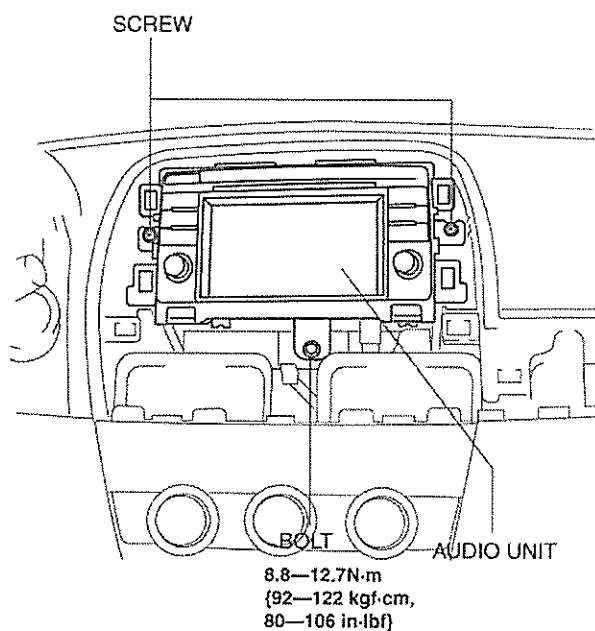


4. Remove the screws.

NOTE:

- When removing the audio unit, the audio unit could interfere with the climate control unit and scratch the climate control unit. Perform the servicing by spreading a cloth in the position indicated in the figure.

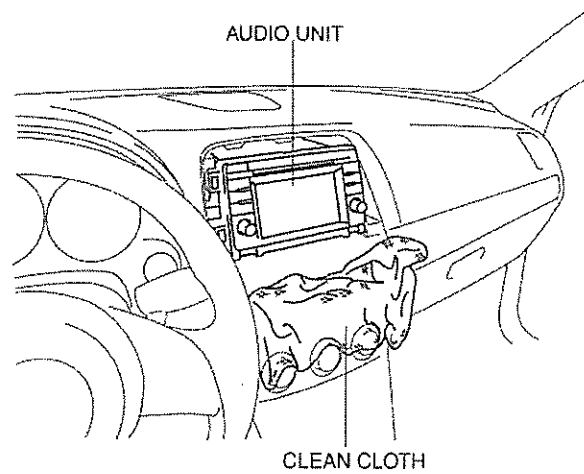


5. Hold the audio unit in the position shown in the figure and pull it outward to disengage clips A, B, C, and D from the instrument panel.

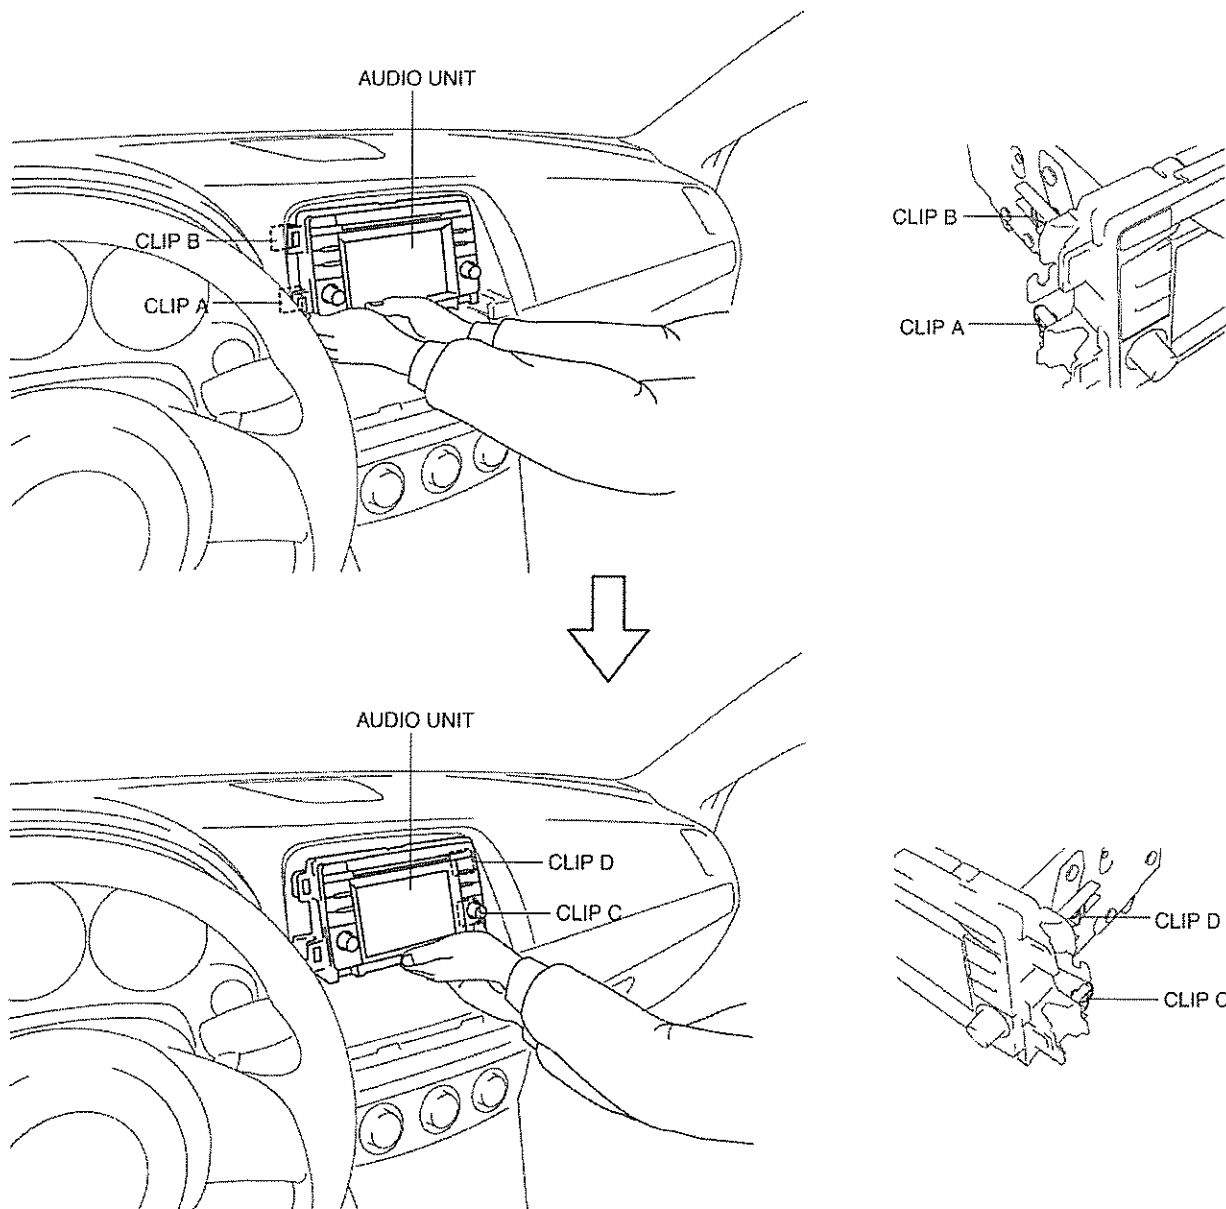


6. Disconnect the connectors.

WITHOUT COLOR LCD

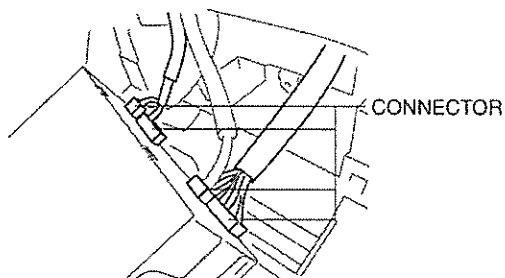


WITH COLOR LCD

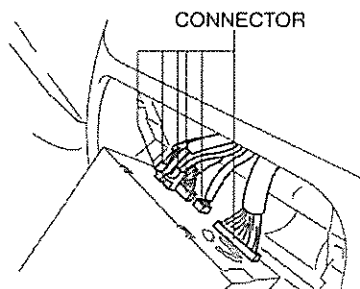

7. Remove the audio unit.


Installation**NOTE:**

- When installing the audio unit, the audio unit could interfere with the climate control unit and scratch the climate control unit. Perform the servicing by spreading a cloth in the position indicated in the figure.

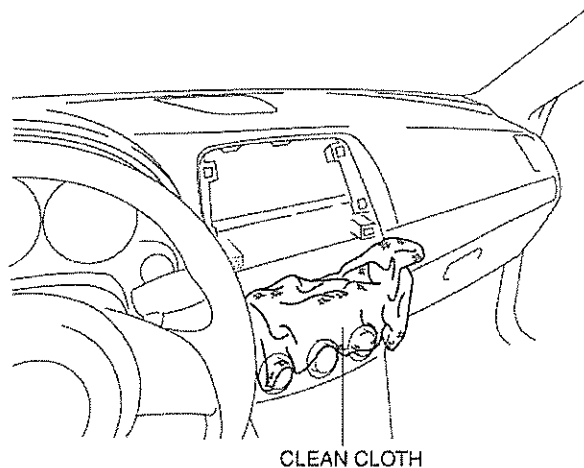


1. Connect all the connectors.


WITHOUT COLOR LCD

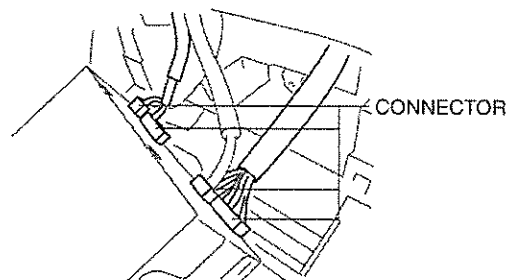

WITH COLOR LCD

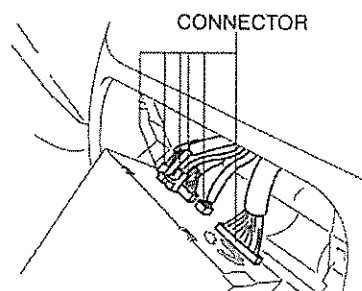


2. Temporarily position the audio unit on the ribs and align the hole positions of the instrument panel with clips.

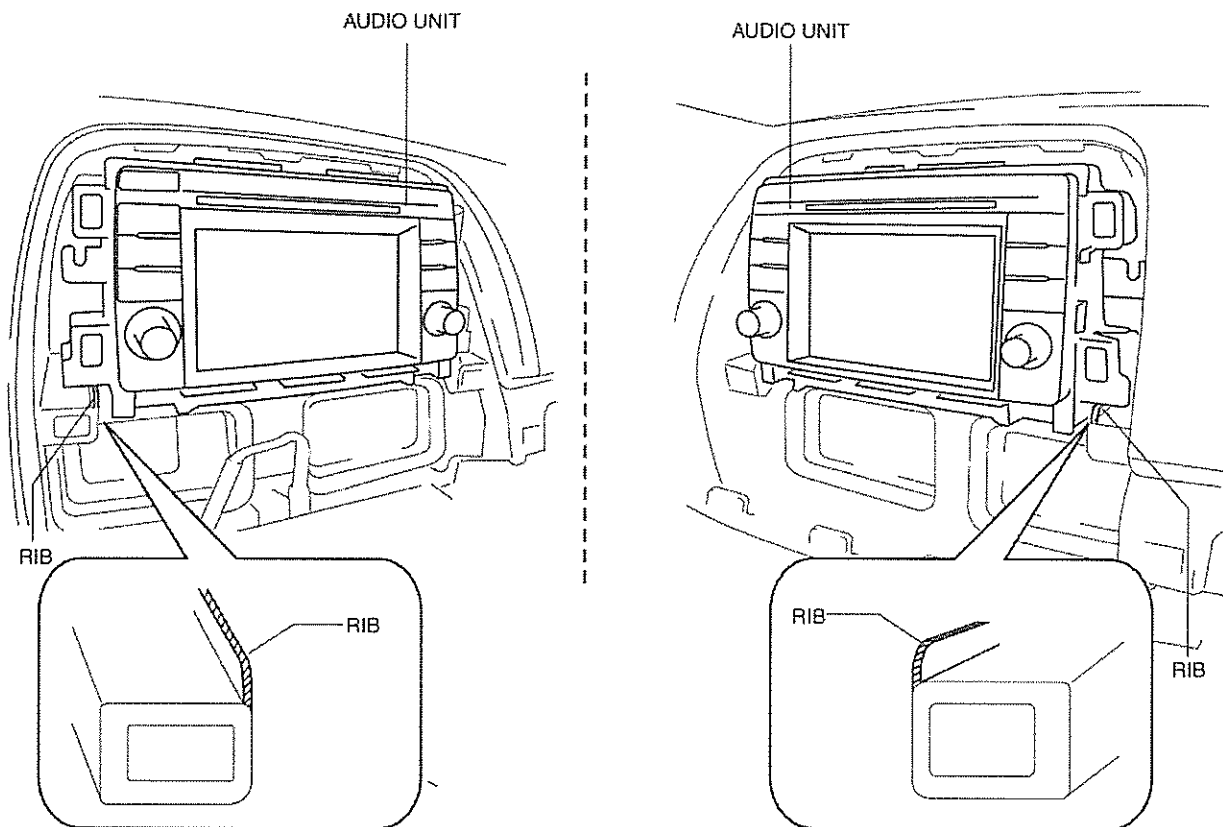


3. Press the audio unit in the position shown in the figure and engage clips to the instrument panel.

WITH COLOR DISPLAY

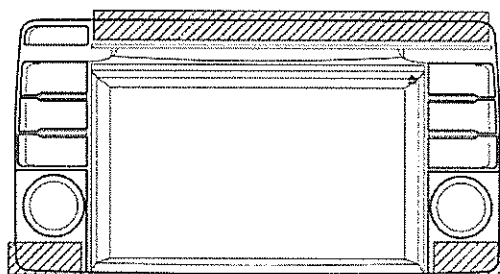


WITHOUT COLOR DISPLAY

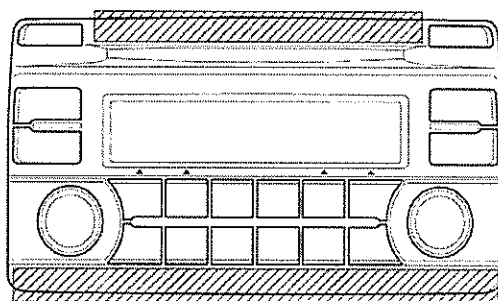**CAUTION:**

- If the audio unit switch area and screen are pressed it could cause a malfunction.

4. Install the screws.

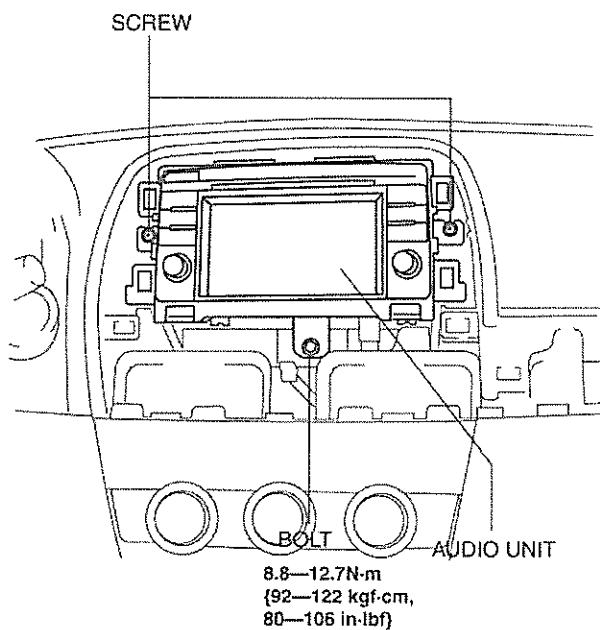

5. Install the bolt.

6. Install the Decoration panel. (See [DECORATION PANEL REMOVAL/INSTALLATION](#).)

7. Connect the negative battery cable. (See [NEGATIVE BATTERY CABLE DISCONNECTION/CONNECTION \(SKYACTIV-G 2.0\)](#).)

[< Previous](#) [Next >](#)

[Back to Top](#)

© 2012 Mazda North American Operations, U.S.A.